

United States Army

Fort Monmouth, New Jersey

Underground Storage Tank Closure and Site Investigation Report

Building 1110
Main Post-West Area

NJDEP UST Registration No. 0081533-170

September 1998

UNDERGROUND STORAGE TANK CLOSURE AND SITE INVESTIGATION REPORT

BUILDING 1110

MAIN POST-WEST AREA NJDEP UST REGISTRATION NO. 0081533-170

SEPTEMBER 1998

PREPARED FOR:

UNITED STATES ARMY, FORT MONMOUTH, NEW JERSEY
DIRECTORATE OF PUBLIC WORKS
BUILDING 167
FORT MONMOUTH, NJ 07703

PREPARED BY:

SMC ENVIRONMENTAL SERVICES GROUP 501 ALLENDALE ROAD KING OF PRUSSIA, PA 19406

PROJECT NO. 2491-308

1110.DOC

TABLE OF CONTENTS

EXECUTIVE SUMMARY	iv
1.0 UNDERGROUND STORAGE TANK DECOMMISSIONING ACTIVITIES	1
1.1 OVERVIEW 1.2 SITE DESCRIPTION	1 2
1.2.1 Geological/Hydrogeological Setting	2
1.3 HEALTH AND SAFETY 1.4 REMOVAL OF UNDERGROUND STORAGE TANK	4 4
1.4.1 General Procedures 1.4.2 Underground Storage Tank Excavation and Cleaning	4 4
1.5 UNDERGROUND STORAGE TANK TRANSPORTATION AND DISPOSAL 1.6 MANAGEMENT OF EXCAVATED SOILS	5 5
2.0 SITE INVESTIGATION ACTIVITIES	6
2.1 OVERVIEW 2.2 FIELD SCREENING/MONITORING 2.3 SOIL SAMPLING	6 6 7
3.0 CONCLUSIONS AND RECOMMENDATIONS	8
3.1 SOIL SAMPLING RESULTS	8

TABLE OF CONTENTS (CONTINUED)

TABLES

Table 1 Summary of Post-Excavation Sampling Activities

 Table 2
 Post-Excavation Soil Sampling Results

FIGURES

Figure 1 Site Location Map

Figure 2 Site Map

Figure 3 Cross Sectional View

Figure 4 Soil Sampling Location Map

APPENDICES

Appendix A NJDEP Standard Reporting Form

Appendix B Site Assessment Summary

Appendix C Waste Manifest

Appendix D UST Disposal Certificate

Appendix E Soil Analytical Data Package

Appendix F Photographs

EXECUTIVE SUMMARY

UST Closure

On June 30, 1998, a fiberglass underground storage tank (UST) was closed by removal in accordance with the New Jersey Department of Environmental Protection (NJDEP) underground storage tank procedures at the Main Post-West area of the U.S. Army Fort Monmouth, Fort Monmouth, New Jersey. The UST, NJDEP Registration No. 0081533-170 (Fort Monmouth ID No. 1110), was located north of Building 1110. UST No. 0081533-170 was a 1,000-gallon No. 2 fuel oil UST.

Site Assessment

The site assessment was performed by U.S. Army personnel in accordance with the NJDEP *Technical Requirements for Site Remediation* (N.J.A.C. 7:26E) and the NJDEP *Field Sampling Procedures Manual*. The sampling and laboratory analysis conducted during the site assessment were performed in accordance with Section 7:26E-2.1 of the *Technical Requirements for Site Remediation*. Soils surrounding the tank were screened visually and with air monitoring equipment for evidence of contamination. Following removal, the UST was inspected for corrosion holes or punctures. No holes or punctures were noted in the UST and no evidence of potentially contaminated soils was observed surrounding the tank. Groundwater was encountered at 6.0 feet below ground surface and no sheen was observed. Samples contained TPHC concentration ranging from non-detect to 506.14 mg/kg.

Site Restoration

Following receipt of all post-excavation soil sampling results, the excavation was backfilled to grade with crushed stone, sand, and native backfill and restored to its original condition.

Conclusions and Recommendations

Based on the post-excavation soil sampling results, soils with TPHC concentrations exceeding the NJDEP soil cleanup criteria for total organic contaminants of 10,000 mg/kg, do not exist in the former location of the UST or associated piping.

No further action is proposed in regard to the closure and site assessment of UST No. 0081533-170 at Building 1110.

1.0 UNDERGROUND STORAGE TANK DECOMMISSIONING ACTIVITIES

1.1 OVERVIEW

One underground storage tank (UST), New Jersey Department of Environmental Protection (NJDEP) Registration No. 0081533-170, was closed at Building 1110 at the Main Post-West area of U.S. Army Fort Monmouth, Fort Monmouth, New Jersey on June 30, 1998. Refer to site location map on Figure 1. This report presents the results of the Department of Public Works= (DPW) implementation of the UST Decommissioning/Closure Plan approved by the NJDEP. The UST was a fiberglass 1,000-gallon tank containing No. 2 fuel oil.

Decommissioning activities for UST No. 0081533-170 complied with all applicable Federal, State and Local laws and ordinances in effect at the date of decommissioning. These laws included but were not limited to N.J.A.C. 7:14B-1 et seq., N.J.A.C. 5:23-1 et seq., and Occupational Safety and Health Administration (OSHA) 1910.146 & 1910.120. All permits including but not limited to the NJDEP-approved Decommissioning/Closure Plan were posted onsite for inspection. The decommissioning activities were conducted by DPW personnel who are registered and certified by the NJDEP for performing UST closure activities. Closure of UST No. 0081533-170 proceeded under the approval of the NJDEP Bureau of Underground Storage Tanks (NJDEP-BUST). The Standard Reporting Form and signed Site Assessment Summary form for UST No. 0081533-170 are included in Appendices A and B, respectively.

Based on inspecting the UST, field screening of subsurface soils and groundwater, and reviewing analytical results of collected soil samples, the DPW has concluded that no significant historical discharges are associated with the UST or associated piping.

This UST Closure and Site Investigation Report has been prepared by SMC Environmental Services Group, to assist the United States Army Directorate of Public Works (DPW) in complying with the NJDEP-BUST regulations. The applicable NJDEP-BUST regulations at the date of closure were the *Interim Closure Requirements for Underground Storage Tank Systems* (N.J.A.C. 7:14B-1 et seq. October 1990 and revisions dated November 1, 1991).

This report was prepared using information collected at the time of closure. Section 1 of this UST Closure and Site Investigation Report provides a summary of the UST decommissioning activities. Section 2 of this report describes the site investigation activities. Conclusions and recommendations, including the results of the soil sampling investigation, are presented in the final section of this report.

1.2 SITE DESCRIPTION

Building 1110 is located in the Main Post-West area of the Fort Monmouth Army Base. UST No. 0081533-170 was located north of Building 1110 and appurtenant copper piping ran approximately five (5) feet southeast from the excavation to Building 1110. A site map is provided on Figure 2.

1.2.1 Geological/Hydrogeological Setting

The following is a description of the geological/hydrogeological setting of the area surrounding Building 1110. Included is a description of the regional geology of the area surrounding Fort Monmouth as well as descriptions of the local geology and hydrogeology of the Main Post area.

Regional Geology

Monmouth County lies within the New Jersey Section of the Atlantic Coastal Plain physiographic province. The Main Post, Charles Wood, and the Evans areas are located in what may be referred to as the Outer Coastal Plain subprovince, or the Outer Lowlands.

In general, New Jersey Coastal Plain formations consist of a seaward-dipping wedge of unconsolidated deposits of clay, silt, and gravel. These formations typically strike northeast-southwest with a dip ranging from 10 to 60 feet per mile and were deposited on Precambrian and lower Paleozoic rocks (Zapecza, 1989). These sediments, predominantly derived from deltaic, shallow marine, and continental shelf environments, date from Cretaceous through the Quaternary Periods. The mineralogy ranges from quartz to glauconite.

The formations record several major transgressive/regressive cycles and contain units which are generally thicker to the southeast and reflect a deeper water environment. Over 20 regional geologic units are present within the sediments of the Coastal Plain. Regressive, upward coarsening deposits are usually aquifers (e.g., Englishtown and Kirkwood Formations, and the Cohansey Sand) while the transgressive deposits act as confining units (e.g., the Merchantville, Marshalltown, and Navesink Formations). The individual thicknesses for these units vary greatly (i.e., from several feet to several hundred feet). The Coastal Plain deposits thicken to the southeast from the Fall Line to greater than 6,500 feet in Cape May County (Brown and Zapecza, 1990).

Local Geology

E ..

i.

Based on the regional geologic map (Jablonski, 1968), the Cretaceous age Red Bank and Tinton Sands outcrop at the Main Post area. The Red Bank sand conformably overlies the Navesink Formation and dips to the southeast at 35 feet per mile. The upper member (Shrewsbury) of the Red Bank sand is a yellowish-gray to reddish brown clayey, medium-to-coarse-grained sand that contains abundant rock fragments, minor mica and glauconite (Jablonski). The lower member (Sandy Hook) is a dark gray to black, medium-to-fine grained sand with abundant clay, mica, and glauconite.

The Tinton sand conformably overlies the Red Bank Sand and ranges from a clayey medium to very coarse grained feldspathic quartz and glauconite sand to a glauconitic coarse sand. The color varies from dark yellowish orange or light brown to moderate brown and from light olive to grayish olive. Glauconite may constitute 60 to 80 percent of the sand fraction in the upper part of the unit (Minard, 1969). The upper part of the Tinton is often highly oxidized and iron oxide encrusted (Minard).

Hydrogeology

The water table aquifer in the Main Post area is identified as part of the "composite confining units", or minor aquifers. The minor aquifers include the Navesink formation, Red Bank Sand, Tinton Sand, Hornerstown Sand, Vincentown Formation, Manasquan Formation, Shark River Formation, Piney Point Formation, and the basal clay of the Kirkwood Formation.

Based on records of wells drilled in the Main Post area, water is typically encountered at depths of 2 to 9 feet below ground surface (bgs). According to Jablonski, wells drilled in the Red Bank and Tinton Sands may produce 2 to 25 gallons per minute (gpm). Some well owners have reported acidic water that requires treatment to remove iron.

Due to the proximity of the Atlantic Ocean to Fort Monmouth, shallow groundwater may be tidally influenced and may flow toward creeks and brooks as the tide goes out, and away from creeks and brooks as the tide comes in. However, an abundance of clay lenses and sand deposits were noted in borings installed throughout Fort Monmouth. Therefore, the direction of shallow groundwater should be determined on a case-by-case basis.

Shallow groundwater is locally influenced within the Main Post area by the following factors:

- X tidal influence (based on proximity to the Atlantic Ocean, rivers, and tributaries)
- X topography

L: .5

- X nature of the fill material within the Main Post area
- X presence of clay and silt lenses in the natural overburden deposits
- X local groundwater recharge areas (i.e., streams, lakes)

Due to the fluvial nature of the overburden deposits (i.e., sand and clay lenses), shallow groundwater flow direction is best determined on a case-by-case basis. This is consistent with lithologies observed in borings installed within the Main Post area, which primarily consisted of fine-to-medium grained sands, with occasional lenses or laminations of gravel silt and/or clay.

Building 1110 located approximately 200 feet southeast of Wampum Brook, the nearest water body. Based on the Main Post topography, the groundwater flow in the area of Building 1110 is anticipated to be to the northwest.

1.3 HEALTH AND SAFETY

Before, during, and after all decommissioning activities, hazards at the work site which may have posed a threat to the Health and Safety of all personnel who were involved with, or were affected by, the decommissioning of the UST system were minimized. All areas, which posed, or may have been suspected to pose a vapor hazard were monitored by a qualified individual utilizing an organic vapor analyzer (OVA). The individual ascertained if the area was properly vented to render the area safe, as defined by OSHA.

1.4 REMOVAL OF UNDERGROUND STORAGE TANK

1.4.1 General Procedures

- X All underground obstructions (utilities, etc.) were identified by the contractor performing the closure prior to excavation activities.
- X All activities were carried out with the greatest regard to safety and health and the safeguarding of the environment.
- X All excavated soils were visually examined and screened with an OVA for evidence of contamination. Potentially contaminated soils were identified and logged during closure activities.
- X Surface materials (i.e., asphalt, concrete, etc.) were excavated and staged separately from all soil and recycled in accordance with all applicable regulations and laws.
- X A Sub-Surface Evaluator from the DPW was present during all site assessment activities.

1.4.2 Underground Storage Tank Excavation and Cleaning

Prior to UST decommissioning activities, surficial soil was removed to expose the UST and associated piping. All free product present in the piping was drained into the UST, and the UST was purged to remove vapors prior to cutting and removal of the piping. After removal of the associated piping, a manway was made in the UST to allow for proper cleaning. The UST was completely emptied of all liquids prior to removal from the ground. Approximately 20 gallons of liquid from the UST and its associated piping were transported by Casie Protank to Casie Ecology Oil Salvage, Inc. facility, a NJDEP-approved petroleum recycling and disposal company located in Vineland, New Jersey. Refer to Appendix C for the waste manifest.

The UST was cleaned prior to removal from the excavation in accordance with the NJDEP-BUST regulations. After the UST was removed from the excavation, it was staged on polyethylene sheeting and examined for holes. No holes or punctures were observed during the inspection by the Sub-Surface Evaluator. Soils surrounding the UST were screened visually and with an OVA for evidence of contamination. No evidence of contamination was observed. Soil screening was also performed along the piping run associated with the UST closure. No contamination was noted anywhere along the piping length. Groundwater was encountered at 6.0 feet bgs and no sheen was observed. See Figure 3 for a cross-sectional view of the excavated area.

1.5 UNDERGROUND STORAGE TANK TRANSPORTATION AND DISPOSAL

The tank was transported to Marpal Disposal Company, Inc. See Appendix D for a copy of the UST disposal certificate and Appendix F for photographs of the UST. The transportation of the UST was in compliance with all applicable regulations and laws.

The UST was labeled prior to transport with the following information:

- X Site of origin
- X Contact person
- X NJDEP UST Facility ID number
- X Former contents

1.6 MANAGEMENT OF EXCAVATED SOILS

Based on OVA air monitoring and TPHC analysis results from the post-excavation soil samples, no soils exhibited signs of contamination. Therefore, the excavated soils were used as backfill following removal of the UST.

2.0 SITE INVESTIGATION ACTIVITIES

2.1 OVERVIEW

The Site Investigation was managed and carried out by U.S. Army DPW personnel. All analyses were performed and reported by U.S. Army Fort Monmouth Environmental Laboratory, a NJDEP-certified testing laboratory. All sampling was performed under the direct supervision of a NJDEP Certified Sub-Surface Evaluator according to the methods described in the NJDEP *Field Sampling Procedures Manual* (1992). Sampling frequency and parameters analyzed complied with the NJDEP-BUST document *Interim Closure Requirements for Underground Storage Tank Systems* (October 1990 and revisions dated November 1, 1991) which was the applicable regulation at the date of the closure. All records of the Site Investigation activities are maintained by the Fort Monmouth DPW Environmental Office.

The following Parties participated in Closure and Site Investigation Activities:

X Subsurface Evaluator: Charles Appleby Employer: U.S. Army, Fort Monmouth

Phone Number: (732) 532-6224 NJDEP Certification No.: 2056

X Analytical Laboratory: U.S. Army Fort Monmouth Environmental Laboratory

Contact Person: Daniel K. Wright Phone Number: (908) 532-4359

NJDEP Company Certification No.: 13461

X Hazardous Waste Hauler: Casie Protank Environmental Services

Contact Person: Bob Corsiglia Phone Number: (609) 696-4401

NJDEP Company Certification No.: 16931

2.2 FIELD SCREENING/MONITORING

Field screening was performed by a NJDEP Certified Sub-Surface Evaluator using an OVA and visual observations to identify potentially contaminated material. Soil excavated from around the tank and appurtenant piping, as well as the UST excavation sidewalls and bottom, did not exhibit any evidence of potential contamination. Groundwater was encountered at 6.0 feet bgs and no sheen was observed.

2.3 SOIL SAMPLING

On June 30, 1998, following the removal of the UST, post-excavation soil samples A, B, C, D, E, F, and DUP B were collected from a total of five (6) locations of the UST excavation. Sample A was collected along the excavation floor at a depth of 9.5 feet bgs. Sidewall samples B, C, D, E and DUP B were collected at a depth of 5.5 feet bgs. Sample F was collected along the former piping length of the excavation, which was approximately five (5) feet in length. The piping sample was collected at a depth of 2.0 feet bgs. All samples were analyzed for total petroleum hydrocarbons (TPHC) and total solids.

U.S. Army personnel in accordance with the NJDEP Technical Requirements and the NJDEP Field Sampling Procedures Manual performed the site assessment. A summary of sampling activities including parameters analyzed is provided in Table 1. The post-excavation soil samples were collected using NJDEP *Field Sampling Procedures Manual* (1992) standard sampling procedures. Following soil sampling activities, the samples were chilled and delivered to U.S. Army Fort Monmouth Environmental Laboratory located in Fort Monmouth, New Jersey, for analysis.

3.0 CONCLUSIONS AND RECOMMENDATIONS

3.1 SOIL SAMPLING RESULTS

To evaluate soil conditions following removal of the UST, post-excavation soil samples were collected on June 30, 1998, from a total of five (6) locations. All samples were analyzed for TPHC and total solids. The post-excavation sampling results were compared to the NJDEP residential direct contact total organic contaminants soil cleanup criteria of 10,000 mg/kg (N.J.A.C. 7:26D and revisions dated February 3, 1994). A summary of the analytical results and comparison to the NJDEP soil cleanup criteria is provided in Table 2 and the soil sampling locations are shown on Figure 4. The analytical data package is provided in Appendix E.

All post-excavation soil samples collected on June 30, 1998, from the UST excavation and from below piping associated with the UST contained concentrations of TPHC below the NJDEP soil cleanup criteria. Samples contained TPHC concentrations ranging from non-detect to 506.14 mg/kg.

3.2 CONCLUSIONS AND RECOMMENDATIONS

The analytical results for all post-excavation soil samples collected from the UST closure excavation at Building 1110 were below the NJDEP soil cleanup criteria for total organic contaminants.

Based on the post-excavation sampling results, soils with TPHC concentrations exceeding the NJDEP soil cleanup criteria for total organic contaminants of 10,000 mg/kg, do not exist in the former location of the UST or associated piping.

No further action is proposed in regard to the closure and site assessment of UST No. 0081533-170 at Building 1110.

TABLES

TABLE 1

SUMMARY OF POST-EXCAVATION SAMPLING ACTIVITIES BUILDING 1110, MAIN POST-WEST AREA FORT MONMOUTH, NEW JERSEY

Page 1 of 1

Sample ID	Date of Collection	Date Analysis Started	Matrix	Sample Type	Analytical Parameters*	Analysis Method
Α	6/30/98	6/30/98	Soil	Post-Excavation	TPHC	OQA-QAM-025
В	6/30/98	6/30/98	Soil	Post-Excavation	TPHC	OQA-QAM-025
C	6/30/98	6/30/98	Soil	Post-Excavation	TPHC	OQA-QAM-025
D	6/30/98	6/30/98	Soil	Post-Excavation	TPHC	OQA-QAM-025
E	6/30/98	6/30/98	Soil	Post-Excavation	TPHC	OQA-QAM-025
F	6/30/98	6/30/98	Soil	Post-Excavation	TPHC	OQA-QAM-025
DUP B	6/30/98	6/30/98	Soil	Post-Excavation	TPHC	OQA-QAM-025

Note:

* TPHC Total Petroleum Hydrocarbons

TABLE 2

POST-EXCAVATION SOIL SAMPLING RESULTS BUILDING 1110, MAIN POST-WEST AREA FORT MONMOUTH, NEW JERSEY

Page 1 of 1

Sample ID/ Depth	Sample Laboratory ID	Sample Date	Analysis Date	Analytical Method Used	Method Detection Limit (mg/kg)	Compound of Concern	Result (mg/kg) *	NJDEP Soil Cleanup Criteria ** (mg/kg)	Exceeds Cleanup Criteria
A/9.5=	3690.01	6/30/98	6/30/98	Total Solid			76.88		
				TPHC	196	Yes	ND	10,000	No
B/5.5 =	3690.02	6/30/98	6/30/98	Total Solid			82.58		
				TPHC	188	Yes	ND	10,000	No
C/5.5=	3690.03	6/30/98	6/30/98	Total Solid			82.17		
				TPHC	187	Yes	ND	10,000	No
D/5.5 =	3690.04	6/30/98	6/30/98	Total Solid			81.58		
•				TPHC	191	Yes	506.14	10,000	No
E/5.5=	3690.05	6/30/98	6/30/98	Total Solid			80.81		
				TPHC	192	Yes	ND	10,000	No
F/2.0=	3690.06	6/30/98	6/30/98	Total Solid			83.07		
				TPHC	186	Yes	ND	10,000	No
DUP B/5.5 =	3690.07	6/30/98	6/30/98	Total Solid			84.14		
				TPHC	182	Yes	ND	10,000	No

Note:


Total Solid results are expressed as a percentage.

NJDEP Residential Direct Contact soil cleanup criteria for total organics

Not detected above stated sample quantitation limit **

TPHC Total Petroleum Hydrocarbons

FIGURES

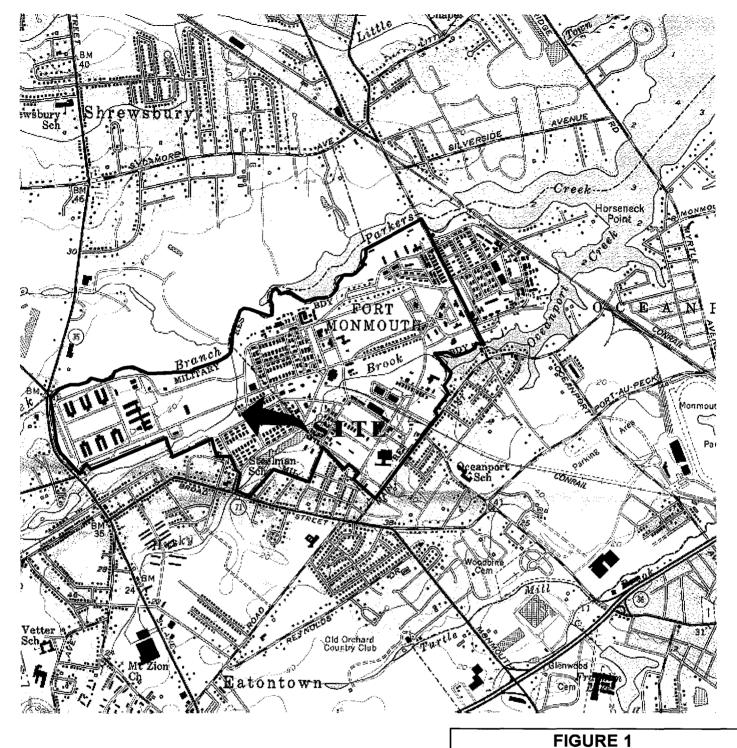



LONG BRANCH, N. J. 40073-C8-TF-024

1954 PHOTOREVISED 1981 DMA 6164 I SE-SERIES V822



SITE LOCATION MAP **Building 1110** Main Post-West Fort Monmouth Army Base Monmouth County, NJ



SMC Environmental


Services Group Engineers, Managers, Scientists & Planners Valley Forge, PA.


SCALE: 1"= 2000'


DATE:

JUNE 1998


Mapped, edited and published by the Geological Survey

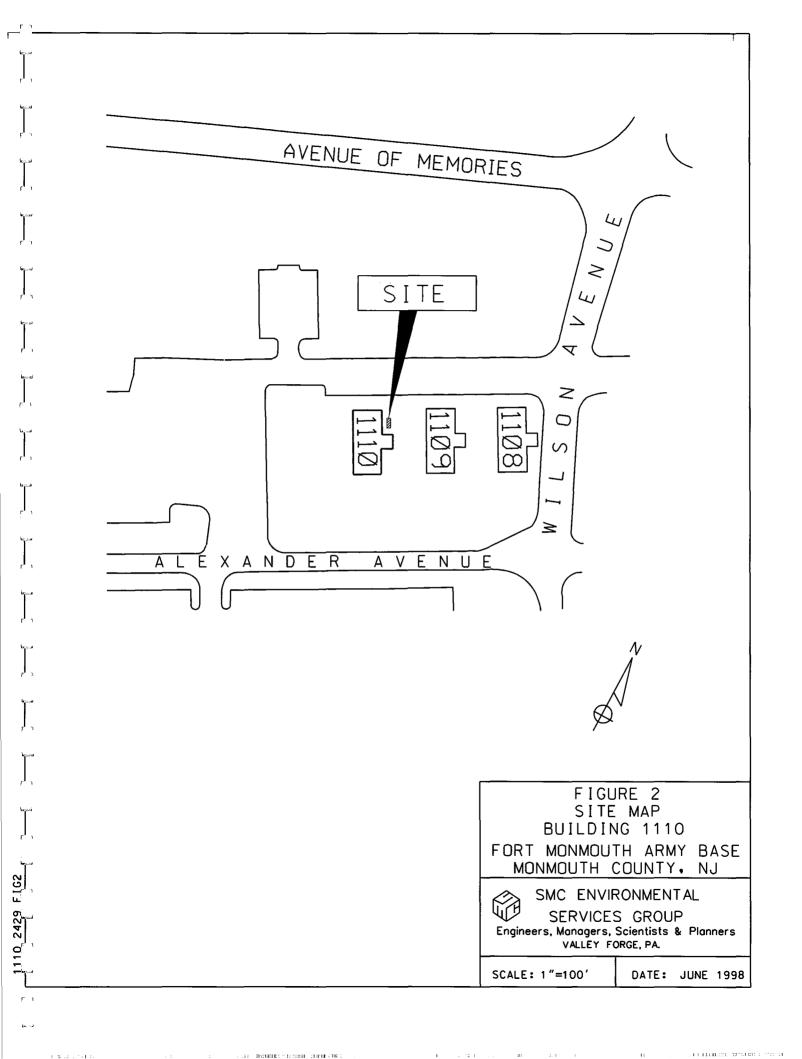

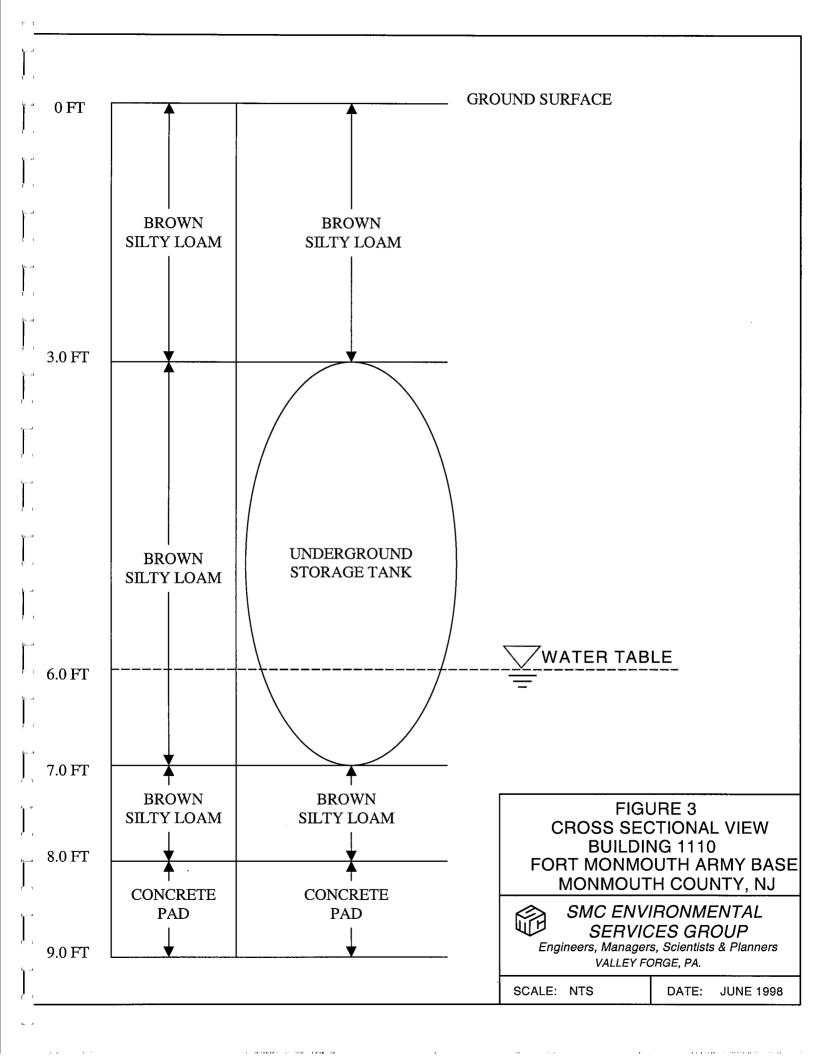

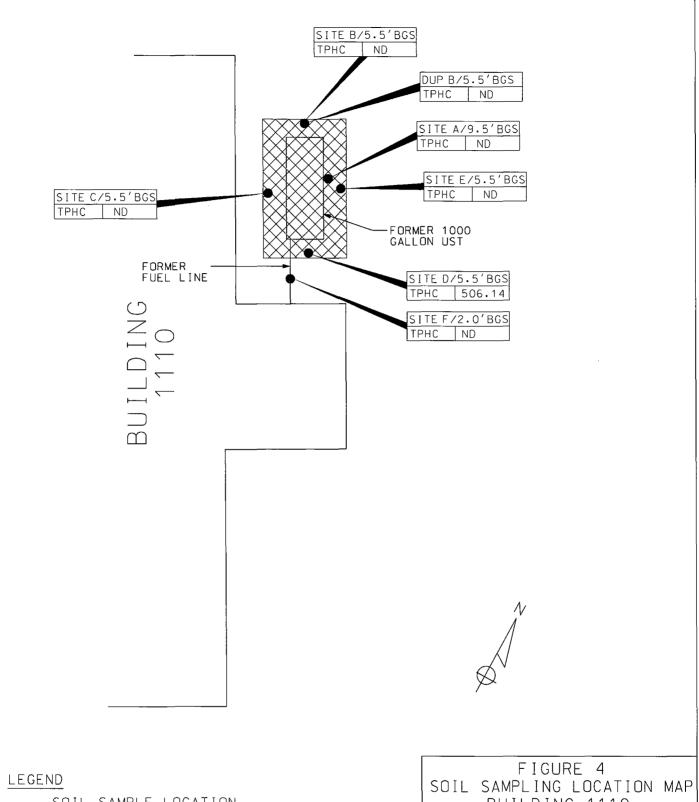

SOIL SAMPLE LOCATION (JUNE 30, 1998)

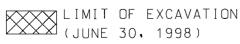

NOTES:

2429

10

Ft

- 1. ALL RESULTS IN MG/KG.
- 2. SEE TABLE 2 FOR NJDEP SOIL CLEANUP CRITERIA
- 3. BGS = BELOW GROUND SURFACE

BUILDING 1110

FORT MONMOUTH ARMY BASE MONMOUTH COUNTY, NJ



SMC ENVIRONMENTAL

SERVICES GROUP

Engineers, Managers, Scientists & Planners VALLEY FORGE, PA.

SCALE: 1"=10'

DATE: JUNE 1998

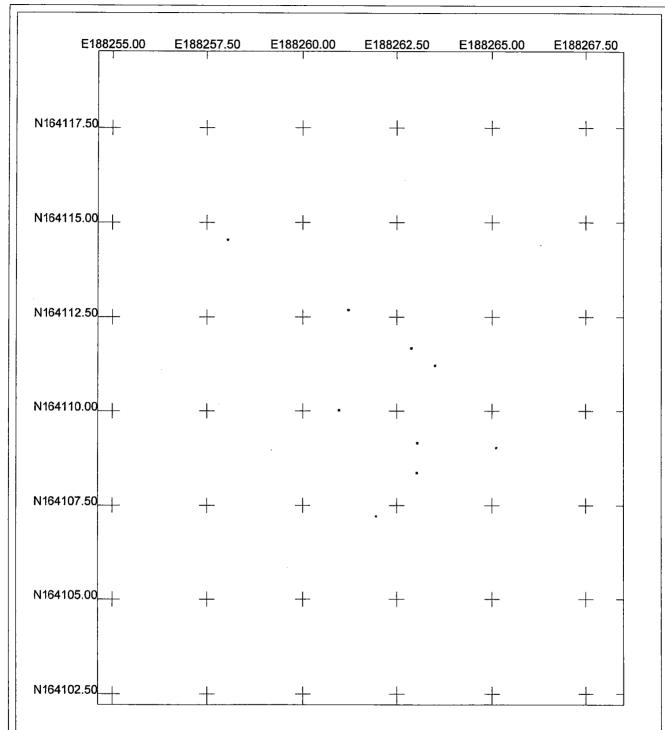


Figure 4 Sampling Locations Map

US State Plane 1983 New Jersey (NY East) 2900 NAD 1983 (Conus)



Scale 1:100 0 3.000 Meters

r113014a.cor 12/10/1998 Pathfinder Office Trimble

Figure 4 GPS Sampling Location Point Data

US State Plane 1983 NJ (NY East) 2900 Nad 1983 (Conus)

Reference Points

Y Coord. (Northing)	X Coord. (Easting		
164114.559	188258.035		
164107.22 164109.037	188261.946 188265.098		
	164114.559 164107.22		

Sample Points

<u>Locations</u>	Y Coord. (Northing)	X Coord. (Easting)				
1110 A	164111.689	188262.877				
1110 B	164112.7	188261.202				
1110 C	164110.031	188260.95				
1110 D	164109.164	188263.035				
1110 E	164111.221	188263.496				
1110 F	164108.373	188263.022				

APPENDIX A NJDEP-STANDARD REPORTING FORM

FOR STATE USE ONL

Check In

STATUS

Active Inactive

_ Yes [

COMCODE

NEW JERSEY DEPARTMENT OF ENVIRONMENTAL PROTECTION

DIVISION OF RESPONSIBLE PARTY SITE REMEDIATION BUREAU OF APPLICABILITY AND COMPLIANCE

Registration and Billing Unit CN 028, Trenton, N.J. 08625-0028 1-609-984-3156

HADEDODOHAD STODAGE TANK

		ITY QUESTIO					
FACILITY UST #_	0081533		Bld	1. 1110			
	s Registration Question ances Act, N.J.S.A. 58:						e of
B. Is this a regis C. Is this a corre There have b signatures)	tration of a proposed or natration of an existing undescribed or amendment to are seen no changes to the face	erground storage tank n existing facility regist cility registration since	not presently registe tration? UST #_00 last submittal. UST	ored?			or to operat
Facility Name ar	ove, please check the appl nd/or Address Change nd/or Address Change r and/or Address Change Person Change	Type of Product(Spills, Leaks, Re	s) Stored eleases Piping Changes	Financial Respondent Substantial Modern Sale or Transforther (please	odification(s) er (Complete	•	ns 4,5,6 &
SECTION A - GI	ENERAL FACILITY IN	FORMATION					
1. Facility Name	MAIN POS	T West					
2. Facility Location	Ft Morne	nuth -	NUMBER AND STREET				
					<u> </u>		
		1 1 1 1 1 1 1	<u> </u>	1111	<u> </u>		
		ا الليلاا ا	CITY OR MUNICIPALITY				
Facility Operator	COUNTY	STATE	ZIP CODE	Contact	BLOCK	1 1 1	LOT
Operator Address	1	PERSON OR TITLE		Tele. No. (Area Code	e)		(Extension
(if different than			NUMBER AND STREET				
#2)					<u> </u>		
			CITY OR MUNICIPALITY				111
	STATE ZII	P CODE					
4. Tank Owner					لتلطط	لللل	
Tank Owner Address			NUMBER AND STREET				111
						111	111
			CITY OR MUNICIPALITY	,			
Contact Person (Tank Owner)	STATE Charles	ZIP CODE APPlaby		Contact 737	533	5224	(Extension)
7. EPA ID#							
Total number of	regulated underground st	torage tanks at facility	1 1 1 1/00000	ata Charles C.C.			

•						B	Ida 11	110		
9. Total regulated underground storage ta	ank capaci	ity at facili	ty (gallon	s)			7"	, 0		e 10
10. Facility Type: A State B Commercial/ Industrial		ounty/Mur ederal	nicipal E F		ritable / Pi idence	ublic Scho	ool G H		as defined	d in
11. Is a copy of the facility site plan submit	ted with th	is registra	ation purs	uant to N.J	I.A.C. 7:14	1B-2?	YES	54:4-2: □ NO	3.1 et sec	<u>}- }</u>
SECTION B - SPECIFIC TANK INFO	DALATIC	T							,	
										t : Lub
ALL underground tanks, including those take 9/3/86) must be registered. Report all tank	cen out of control of control of the	operation tus chang	(UNLESS	STHE TAN	IK WAS R y submitte	EMOVEE	FROM T	THE GROU	JND PRIC	T
1. Tank Identification Number	TANK	NO.	TANI	(NO.	TANK	(NO.	TAN	(NO.	TAN	V N
2. CAS Number (hazardous substances only)		! ! ! !	1 ! ! !	1 ! 1 1	1 ! ! !		1 1 1		 	ا ر کسید د د د
3. Date Tank Installed (Month/Day/Year)	Mo. Day	Year	Mo. Day	Year	Mo. Day	Year	Mo. Day	Year	Mo. Day	Ye
4. Tank Size (gallons)									1	
5. Tank Contents (Mark one "X" for each tank)	 		 		 		1	1 1 1 1	╂╌┵╌	1
A. Leaded gasoline		<u> </u>						J		 !
B. Unleaded gasoline									1	Ī
C. Alcohol endriched gasoline										ic al
D. Light diesel fuel (No. 1-D)	!			1						7
E. Medium diesel fuel (No. 2-D)		<u> </u>	 	! 				ļ		- Company
F. Waste Oil	1		1	<u></u>		<u> </u>				
G. Kerosene (No. 1)	 	'	 		 	-			<u> </u>	
H. Home heating oil (No. 2)	 	+	-		 	 	 		 	-
J. Heating oil (No. 4)	 		 	. !					 	(ram)
K. Heavy heating oil (No. 6)	 		 				 			
L Aviation fuel	 	-	 				 		├ -	
M. Motor oil	 		 	- 			 			
N. Lubricating oil			 			 			}	
P. Sewage Q. Sewage sludge	 		 		 		 	1	 	
R. Other hazardous substances (specify)	 		 		 		 		 	
S. Hazardous waste (specify ID number)	 		+				 		 	
T. Mixtures (please specify)	+		 		ļ ⁻				 	
U. Emergency spill tank (specify substance)	 		 		 		 		 	
V. Other petroleum products (please specify)			 		 		 		 	T ST
W. Other (please specify)	4		 		 				 	
6. Tank & Piping Construction	Tank	Piping	Tank	Piping	Tank	Piping	Tonk	Dining	Tonk	
(Mark one each for both tank & piping)	I all K	riping	I alik	Libing	Idilk	Piping	Tank	Piping	Tank	Pip
A. Bare Steel										7.3
B. Cathodically protected steel	111									
C. Fiberglass-coated steel			1-1-		1-1-1-					
D. Fiberglass-reinforced plastic			111							1.
E. Internally lined										
F. Other (please specify)	 		<u> </u>	···	<u> </u>					· · · · · · · · · · · · · · · · · · ·
7. Tank & Piping Structure	Tank	Piping	Tank	Piping	Tank	Piping	Tank	Piping :	Tank	Pin
(Mark one each for both tank & piping)							l ,, .			
A. Single wall			1-1-1-		}- }		\vdash			
B. Double wall	 		111	<u>· 1 1 </u>	1-1-			1 1		<u> -</u>
C. Other (please specify)					 		ļ		2 1 41,50	<u></u> †
8. Type of Monitoring/Detection System	Tank	Piping	Tank	Piping	Tank	Piping	Tank	Piping	Tank **	_Pi₄
(Mark all that apply for both tank & piping) A. Statistical Inventory Reconciliation				Π.				- []		
B. Manual Tank Gauging	++	-+	+++		 					-
C. Inventory Control	+++	- -			 		- - -	++-	 	
D. Interstitial	+++	- . 	1-1-1-		 - - -					987 To
E. Precision Test	+++		1-1-		 			- 1-24 2		
F. Ground water observation wells	+++		 		1-1-					
G. Vapor observation wells	111		1 + -					17		
H. In-tank (automatic) monitoring gauge	111		1							

J. Periodic Tank Test

						Bldg.	1/20	2		
Tark Identification Number	TAN	K NO.	TANI	NO.	TAN	IK NO.	_	NK NO.	TANI	(NO
Tank Identification Number 8. Type of Monitoring/Detection System	Tank	Piping	Tank	Piping	Tank	Piping	Tank	Piping	Tank	Din
K. None		, ip.i.ig		. ibiii.ia		-iping	Idik	ripling	lank	Pip
□ Other (please specify) ○ Overfill Protection (tank only)	 				 					
(Mark one X for each tank)										
A. Yes	1 -	\neg	٦	7	l r	_			Г	\neg
B. No	1						 -	 	 	-
0. Spill Containment Around Fill Pipe	1				1					
(Mark one X for each tank)	_		_		١,	<u>.</u>	}		_ ا	
A. Yes	1		 	-						
B. No	 -		ļ <u>-</u>				<u> </u>	<u> </u>	<u> </u>	
11. Tank Status (Mark one X for each tank) A. In-use	Tank	Piping	Tank	Piping	Tank	Piping	Tank	Piping	Tank	Pip
B. Empty less than 12 months				1			1 1	!		
C. Empty 12 months or more										
D. Emergency spill tank (sump)							1 + +			
E. Emergency backup generator tank	1						1 ! !			
F. Abandoned in Place	+				 				 	
G. Removed	+		 		 		 		 !!	
H. Other (please specify)			 		 				 	
12. If box 11B, C, or D above has been	Mo. Day	/ Year	Mo. Day	Year	Mo. Da	y Year	Mo. Da	ıy Year	Mo. Day	Yes
marked, indicate the estimated date						1 1	1, 1,			1
last used (month/day/year)	TAN	NK NO.	TAN	K NO.	7.0	IK NO.		NIC NO	TANK	MO
13. Closure Information - Tank ID No.	0		IAN	K NO.	IAN	T NO.	1.5	NK NO.	TANK	NO.
	Mo. Day		Mo. Day	Year	Mo. Da	v Year	Mo.	Day: Year	Mo., Da	V Y
	MO. DE	-		1 1 1		,		1 1 1 1		
A. Date abandoned in place	+ + + +	1 1 1	1 1	1 1 1	! ! !		} - 	1 1 1 1	 	· 1
B. Date taken temporarily out of service		1111		11::	1111	1111	1-1-	1 1 1 1 1	1 . ! !	
C. Date removed	0630	0 1997				1 1 1		1 1 1 1	1 1	: 1
D. Date of Sale or Transfer				1:	1			1 1 1 1 1	1 1	1
			1		 	'			 	<u>-</u>
E. TMS # (if applicable)	100	12 may 1	מהחוצ						1	
	Fed C	Mass 1	ngk.		 		1			
F. ISRA # (if applicable)			ngs.							
	SIBILITY ibility Ass	Y urance Me		as required	in 40 Ci	FR 280? [YES	s 🗌 NO		
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Respons	SIBILITY ibility Ass	Y urance Me		as required		FR 280? [S NO		
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Respons Please list the appropriate financial informa	SIBILITY ibility Ass	Y urance Me						 \$	mount	
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Respons Please list the appropriate financial information Type	SIBILITY ibility Ass ation below	Y urance Me			Carrier /			 \$		
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Respons Please list the appropriate financial information Type Type Effective Date Expiration SECTION D - MONITORING SYSTE	SIBILITY ibility Ass ation below Date EMS monitoring	y urance Me	chanism	Policy N	Carrier Aumber	Issuing Ag	gency	\$		
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Respons Please list the appropriate financial information Type Type Effective Date Expiration SECTION D - MONITORING SYSTE	SIBILITY ibility Ass ation below Date EMS monitoring	y urance Me	chanism	Policy N	Carrier Aumber	Issuing Ag	gency	\$	mount] NO
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Respons Please list the appropriate financial information Type Type Effective Date Expiration SECTION D - MONITORING SYSTE Does this facility have a release detection in the second sec	SIBILITY ibility Ass ation below / Date EMS monitoring ast meet to	y urance Me w: g system w	chanism	Policy N	Carrier Aumber	Issuing Ag	gency	\$	mount] NC
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Respons Please list the appropriate financial information Type Type Effective Date Expiration SECTION D - MONITORING SYSTE Does this facility have a release detection of "No", please be aware that the facility mu SECTION E - RECORDKEEPING/C	SIBILITY ibility Ass ation below Date EMS monitoring ust meet the	y system whe appropr	chanism	Policy None	Carrier / Number with N	Issuing Ag	gency B-6? Page 4		mount YES [
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Respons Please list the appropriate financial information of the section of th	SIBILITY ibility Ass ation below Date EMS monitoring ast meet the	y system whe appropr	chanism hich is in iate dead	Policy Nompliance ine. (See "	Carrier / Number with N Dates to	Issuing Ag	gency B-6? Page 4		YES _	tire fa
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Response Please list the appropriate financial information of the section of t	SIBILITY ibility Ass ation below Date EMS monitoring ast meet the	y system whe appropriately facility basistems for a	chanism hich is in iate dead	Policy Nompliance ine. (See "	Carrier / Number with N Dates to in compling?	J.A.C. 7:14 Know" on	gency B-6? Page 4		for the en	tire fa
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Respons Please list the appropriate financial information of the second secon	SIBILITY ibility Assation below Date EMS monitoring ast meet the compliance of the	y system whe appropriately basistems for a and maintal	chanism hich is in iate deadi	Policy formalismost properties and pipulant to N.J.	Carrier And Number of with N. Complete to in completing?	J.A.C. 7:14 Know" on iance requi	gency B-6? Page 4	\$_Ai	for the en	tire fa
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Response Please list the appropriate financial information Type Type Type Effective Date Expiration SECTION D - MONITORING SYSTE Does this facility have a release detection of the Type answer all the questions in this section of the Type Type answer all the questions in this section of the Type Type Type Type Type Type Type Typ	SIBILITY ibility Assetion below Date EMS monitoring ist meet the compliance of the	y system whe appropriately basistems for a and maintalion of monitors.	chanism hich is in iate dead s. Any or ill steel tar ined purs itoring sys	Policy for the compliance ine. (See "the tank not the tank and pipulant to N.J. tems maintens	Number Number	J.A.C. 7:14 Know" on iance required 4B-5?	gency B-6? Page 4 res a "N	\$_Ai	for the en	tire fa
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Respons Please list the appropriate financial information of the second of th	SIBILITY ibility Assetion below Date EMS monitoring ist meet the compliance of the	y system whe appropriately basistems for a and maintalion of monitors.	chanism hich is in iate dead s. Any or ill steel tar ined purs itoring sys	Policy for the compliance ine. (See "the tank not the tank and pipulant to N.J. tems maintens	Number Number	J.A.C. 7:14 Know" on iance required 4B-5?	gency B-6? Page 4 res a "N	\$_Ai	for the en	tire fac
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Respons Please list the appropriate financial information of the second of th	SIBILITY ibility Assation below Date EMS monitoring ist meet the compliant of the complia	y system whe appropriately basistems for a and maintalion of monimeration and repair and	chanism hich is in iate dead! s. Any or ill steel tar ined purstoring systems.	Policy Notes that not have and pipuant to N.J. tems maint records ke	Number Number with N. Dates to in compling? A.C. 7:1 tained by	J.A.C. 7:14 Know" on iance required 4B-5?	gency B-6? Page 4 res a "N	\$_Ai	for the en YES YES YES YES YES	
F. ISRA # (if applicable) SECTION C - FINANCIAL RESPON Does this facility have a Financial Respons Please list the appropriate financial information of the ap	SIBILITY ibility Assation below Date EMS monitoring ist meet the compliant of the complia	y system whe appropriately basistems for a and maintal ion of monimum repair and m-site pursi	chanism hich is in iate dead! s. Any or all steel tarined purs inventory uant to N.	Policy Notes and pipuant to N.J. tems maintrecords ke	Number Number with N. Dates to in compling? A.C. 7:1 tained by ppt on-sit	J.A.C. 7:14 Know on iance required 4B-5? the owner	gency B-6? Page 4 res a "N	\$_Ai	for the en	tire fac

IMPORTANT INFORMATION

	1,41	II ORTANI EN ORMATION	i
FEE:	processing. Registration and Bi	illing Schedule can be found in N.J.A.C. 7:14B.	ह ं ाग
PENALTY:	Failure by owner or operator of	a regulated underground storage tank to comply with any requirement of the State U.	
	If a discharge or spill occurs, the	e NJDEP Hotline at (609) 292-7172 must be called IMMEDIATELY - 24 hours a day) param
			
December 22, 1988	- All new federally regulated ta	ank systems must have cathodic protection and spill/overfill protection.	L: IN
September 4, 1990	- All new State-only regulated	tank systems must have cathodic protection and spill/overfill protection.	
December 22, 1990	 All federally regulated piping 	g must have begun leak detection.	etensis.
February 19, 1993	 All federally regulated tank s 	ystems must maintain financial responsibility assurance.	r i T
December 22, 1993	 All federally regulated tank s 	ystems must have begun leak detection.	
December 22, 1998	— All regulated tanks shall insta	all cathodic protection and spill/overfill protection.	- Verteed
		CERTIFICATIONS	L
			<u> </u>
CERTIFICATION	NO. 1:		l:
Must be signed by th	ne highest ranking individual at th	he facility with overall responsibility	· (a
		•	. ,
inaccurate or incomp do not believe to be the penalties."	plete information and that I am co true. I am also aware that if I kn Ames OFF (Typed / Printed Name)	committing a crime of the fourth degree if I make a written false statement who nowingly direct or authorize the violation of any statute, I am personally liable (Signature).	ich
	(Title)	$\frac{6/30/98}{\text{(Date)}}$	
	,		
		of at least the level of vice preci dent	
_			
 For a municipality 	, State, Federal or other public ag	gency, by either a principal executive officer or ranking elected official	
documents, and that submitted informati submitting false, in- statement which I do	t based on my inquiry of those indo on is true, accurate and complete accurate or incomplete informatio to not believe to be true. I am al	dividuals immediately responsible for obtaining the information. I believe that it. I am aware that there are significant civil and criminal penalties for knowing on and that I am committing a crime of the fourth degree if I make a written to the fourth degree.	ut th ngl fals
December 22, 1990 — All federally regulated piping must have begun leak detection. February 19, 1993 — All federally regulated tank systems must maintain financial responsibility assurance. December 22, 1993 — All federally regulated tank systems must have begun leak detection. December 22, 1998 — All regulated tanks shall install cathodic protection and spill/overfill protection. CERTIFICATIONS NOTE: IF THE PERSON SIGNING CERTIFICATION NO. 2 IS THE SAME AS THE PERSON SIGNING CERTIFICATION NO. 1, THEN CERTIFICATION NO. 2 NEED NOT BE SIGNED. (If different persons are required to sign No. 1 and No. 2, then they must do so.) CERTIFICATION NO. 1: Must be signed by the highest ranking individual at the facility with overall responsibility "I certify under penalty of law that the information provided in this document is true, accurate and complete to the best of knowledge, information and belief. I am aware that there are significant civil and criminal penalties for knowingly submitting fai inaccurate or incomplete information and that I am committing a crime of the fourth degree if I make a written false statement white do not believe to be true. I am also aware that if I knowingly direct or authorize the violation of any statute, I am personally liable the penalties." — MR Tames OFF (Typed / Printed Name) Signature) (Signature) (Signature)			
	(Title)	(Date)	
CERTIFICATION	(NO.3:		
If applicable, must	be signed by the individual who i	is certified to perform services.	
knowledge, informatinaccurate or income do not believe to be	ation and belief. I am aware that uplete information and that I am cetrue. I am also aware that if I kn	t there are significant civil and criminal penalties for knowingly submitting facommitting a crime of the fourth degree if I make a written false statement whin nowingly direct or authorize the violation of any statute, I am personally liable	alse ich
(Typed / Printed)	Izme) (Title)	(Signature) (Date)	

APPENDIX B

SITE ASSESSMENT SUMMARY

New Jersey Department of Environmental Protection

Site Remediation Program

UST Site/Remedial Investigation Report Certification Form

APPENDIX C

WASTE MANIFEST

CASIE / PROTAJK ENVIRONMENTAL SERVICES

leas	NON-HAZARDOUS i. Generator's US EPA ID No.	2 Page 1	T			_
Ì	MANIFEST N 1 3 2 1 0 0 2 0 5 9 1 3 0 7 3	of				
	Generator's Name and Mailing Address U.S. Army Com. Elec. Command C/O Joe Fallon/Bldg	A. Non-ha. NHZ02		anifest Docu	ıment Numb	er
ł	AHn: SELFM-AC-EV Fort Monmouth NJ 07703	B. State Ge				\neg
	4 Generator's Phone 732 1 532~6223	SAM	E			
İ	5. Transporter : Company Name 5. US EPA ID Number					
-	Casie Ecology Oil Salvage, Inc. N J D:0 4 5 9 9 5 6 9 3 1 7 Transporter 2 Company Name a US EPA ID Number	C State Tra		1 6 9 3	<u> 1 </u>	
		E. State Tra			596-440. 5191711	_
Ì	9 Designated Faculty Name and Site Address 10 US EPA ID Number	4. 0.4.2		<i>\</i>	<u> </u>	9
	Casie Ecology Oil Salvage, Inc. T/A	F Transpor				
	3209 N. MIll Rd / Casie Protank			4D1HP05		
	Vineland NJ 08360		13 Phone (6	09) 696	-4401	4
	MI LIS BOT Description in a Joing Proper Shipping Name Hazard Class and ID Number No.		Total Santit	1.001	Vaste No	
a !	Combustible liquid. n.c.s.(Fuel Oil)		(JE))1		
7	NA1993, PGIII	T T.X	1990	i	5. 5 . 7	۱ ا
E	1001	110-2	0:0:1	1 6 1 1	D 7 8	-
3						
0					;	
					···	
	g .			<u> </u>		\dashv
1				L 1		
1	Additional Descriptions for Materials Listed Above Additional Descriptions Additional Descriptions for Materials Listed Above	К малста	Codes for	Wastes Liste	d Above	
	L90%oil/sed. 10%wtr.					
1	3 C					-
}	0 3	5 :		_c	1 ;	
	15 Seed at Handling instructions and Additions, information					
		,				
	a. <u>24 Hr. Emergency</u> Response #609 <u>695-4401 K. Ambro</u> sia ERG# 18	28				
1	16 GENERATOR'S CERTIFICATION: I bered, deciare that the contents of this consignment are fully and acc	urately descri	bed above		 	_
	proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper corlacording to applicable international and national government regulations.			•		
	I hereby certify that the above-named material is not hazardous waste as defined by 40 CFR Part 261, 264 and	279 or any ap	olicable state	e law.		
	Propertyped yeme Signature	Om	-111	Mon	nth Day Ye	ear
L	Joseph III. Fallon Deph	11.70	CUS	7 01	4131019	8
T R	17 Transporter : Acknowledgement of Receipt of Materials					
A N S	Printed typed Name Sighaturgy Sighaturgy	- pl	_	Mon	ith Day Yo	ear V
P	18 Transporter 2 Acknowledgement of Pederot of Materials	2000		101	71017	<u>5</u>
WE TH	Printed Typed Name Signature			Mon	oth Day Ye	ear
R	<u>, , , , , , , , , , , , , , , , , , , </u>					Ц
•	19 Discrepancy indication Space					
A						
1.	Faculty Owner or Oberator, Certification of receipt of non-nazardous materials covered by this manifest except as	s noted in Item	19.			
	Printed Type Shame Signature Signature				,	ear
				1 1	1 1 1	

APPENDIX D UST DISPOSAL CERTIFICATE

APPENDIX E SOIL ANALYTICAL DATA PACKAGE

US ARMY FT. MONMOUTH ENVIRONMENTAL LABORATORY **NJDEPE # 13461**

REPORT OF ANALYSIS

Client:

U.S. Army

DPW, SELFM-PW-EV

Bldg. 173

Ft. Monmouth, NJ 07703

Project:

Total Petroleum Hydrocarbons

98-0001 Bldg. 1110

Project #

3690

Date Rec.

06/30/98

Date Compl. 07/07/98

Released by:

Daniel K. Wright Date:

Laboratory Director

Table of Contents

Section	Pages
Cover Sheet	1
Table of Contents	2
Method Summary	3
Conformance/Non-Conformance	4
Chain of Custody	5-6
Results Summary	. 7
Initial Calibration Summary	8-9
Continuing Calibration Summary	10-12
Surrogate Results Summary	13
MS/MSD Results Summary	14
Quality Control Spike Summary	15
Raw Sample Data	16-29
Laboratory Deliverable Checklist	30

Method Summary

NJDEP Method OQA-QAM-025-10/97

Gas Chromatographic Determination of Total Petroleum Hydrocarbons in Soil

Fifteen grams (15g)(wet weight) of a soil sample is added to a 125 mL acid cleaned, solvent rinsed, capped Erlenmeyer flask. 15g anhydrous sodium sulfate is added to dry sample. Surrogate standard spiking solution is then added to the flask.

Twenty five milliliters(25mL) Methylene Chloride is added to the flask and it is secured on a gyrotory shaker table. The agitation rate is set to 400rpm and the sample is shaken for 30 minutes. The flask is the removed from the table and the particulate matter is allowed to settle. The extract is transferred to a Teflon capped vial. A second 25mL of Methylene Chloride is added to the flask and shaken for an additional 30 minutes. The flask is again removed and allowed to settle. The extracts are combined in the vial then transferred to a 1mL autosampler vial.

The extract is then injected directly into a GC-FID for analysis. The sample is analyzed for petroleum hydrocarbons covering a range of C8-C42 including pristane and phytane. Total Petroleum Hydrocarbon concentration is determined by integrating between 5 minutes and 22 minutes. The baseline is established by starting the integration after the end of the solvent peak and stopping after the last peak.

The final concentration of Total Petroleum Hydrocarbons is calculated using percent solid, sample weight and concentration.

PHC Conformance/Non-conformance Summary Report

	<u>No</u>	<u>Yes</u>
1.Method Detection Limits provided.		<u> </u>
2. Method Blank Contamination - If yes, list the sample and the corresponding concentrations in each blank.		
3. Matrix Spike Results Summary Meet Criteria. (If not met, list the sample and corresponding recovery which falls outside the acceptable range).		
4. Duplicate Results Summary Meet Criteria. (If not met, list the sample and corresponding recovery which falls outside the acceptable range).		
5. IR Spectra submitted for standards, blanks, & samples	N	IA
6. Chromatograms submitted for standards, blanks, and samples if GC fingerprinting was conducted.		
7. Analysis holding time met. (If not met, list number of days exceeded for each sample)		
Additional Comments:		

Laboratory Authentication Statement

I certify under penalty of law, where applicable, that this laboratory meets the Laboratory Performance Standards and Quality Control requirements specified in N.J.A.C. 7:18 and 40 CFR Part 136 for Water and Wastewater Analyses and SW 846 for Solid Waste Analysis. I have personally examined the information contained in this report, and to the best of my knowledge, I believe that the submitted information is true, accurate, complete, and meets the above referenced standards where applicable. I am aware that there are significant penalties for purposefully submitting falsified information, including the possibility of a fine and imprisonment.

Daniel K. Wright
Laboratory Manager



Fort Monmouth Environmental Testing Laboratory

Bldg. 173, SELFM-PW-EV, Fort Monmouth, NJ 07703

Tel (732)532-4359 Fax (732)532-3484 EMail appleby@doim6.monmouth.army mil

NJDEP Certification #13461

Chain of Custody Record

Customer: C. Acole	hy-DAN	Project No:	98.000	/				Anal	ysis Pa	rameter	S		Comments:
Phone #: 26224	7	Location: 4	3.1110				23					į	*= SAMPLES KEPT
()DERA (X)OMA ()Oth	er:	81533	-170			2	OCL				1		BELOW 4°C.
Samplers Name / Company	: GTARY DIM	ARTINIS-	- TUS	Sample	#	10	(V)		1			3	
Lab Sample LD S	Sample Location	Date	Time	Туре	bottles	1	12	:			!	. 0	Remarks / Preservation Method
369,0001	1110-A	630-98	0923	Soil	1,	\cong	\times					ND	EXC. FLOOR @ 9.5' *
02	${\mathcal B}$		0901									NS	SIDEWALL @ 5.5'
03	\mathcal{C}		0905								ļ	ND	
04	D		0912								ļ	No	
0.5	É		0908									NA	
$\delta \dot{e}$	F		0919								-	ND	Piping Run @ 2.0' FIELD DUFLIKATE
07	DUP	V		4	 	4	<u> </u>				-	_	FIELD DUFLICATE
				1							ļ		
1. 1.		10-		, , ,		, , ,		200	=		1		1 0 0 11
MOTE: OUR (# AST	(903) (AUBRATE	6 (2) (5)	Open (H	4 4 L	KOL	1/9/	6	(18) () (YX	(3. 0.1	1 6 3	1-48	by 17. Dit spector 1.5.
		- 1	,								 		
											 		
1							-				ļ		·
X	T				ļi						 	لـــــا	
Relinquished by (signstally)	Date/Time: 530-98 //30	Received by (s	signature):		Relinq	juished l	oy (sign	iature).	1	Date/Time:	Receiv	red by (signature) [.]
Joseph Company		SH C									-		
Relinchished by (signature)	Date/Time:	ime: Received by (signature): Relin		Reling	uished b	oy (sign	ature)		Date/Time:	Recen	red by (signature):	
Description (32 H 66P)	1 251 1 1 1 25					D .	DV:	The Cat	770 50	2001 110	T7.00	5 //	รยา
eport Type ()Full, &)Reduced, ()Standard, ()Screen / non-certified													
rumaroung time. Mastandard 4 Wi	NS, CANUSII DAYS.	C MOAF Vere	al Hrs.										

Client:

U.S. Army

Lab. ID#:

3690

DPW. SELFM-PW-EV

Date Rec'd:

30-Jun-98

Bldg. 173

Analysis Start:

30-Jun-98

Ft. Monmouth, NJ 07703

Analysis Complete:

07-Jul-98

Analysis:

OQA-QAM-025

UST Reg. #:

Matrix:

Soil

Closure #:

Analyst:

D.DEINHARDT

DICAR #:

Ext. Meth:

Shake

Location #:

B. 1110

Ext. Meth:	Shake			Location #:		B. 1110
Sample	Field ID	Dilution Factor	Weight (g)	% Solid	MDL (mg/kg)	TPHC Result (mg/kg)
3690.01	1110-A	1.00	15.57	76.88	196	ND
3690.02	1110-B	1.00	15.17	82.58	188	ND
3690.03	1110-C	1.00	15.26	82.17	187	ND
3690.04	1110-D	1.00	15.06	81.58	191	506.14
3690.05	1110-E	1.00	15.17	80.81	192	ND
3690.06	1110-F	1.00	15.24	83.07	186	ND
3690.07	1110-DUP	1.00	15.34	84.14	182	ND
METHOD BLANK	TBLK 122	1.00	15.00	100.00	157	ND

ND = Not Detected

MDL = Method Detection Limit

Daniel K. Wright

Laboratory Director

Calrpt

. rnt

Response Factor Report GC/MS Ins

Method : C:\HPCHEM\1\METHODS\TPH43.M (Chemstation Integrator)

Title : TPHC Calibration 06/05/97 21 peaks

Last Update : Thu Jun 11 14:59:41 1998

Calibration Files

100 =T05959.D 50 =T05960.D 20 =T05961.D

=T05962.D 5 =T05963.D

		Compound	100	50	20	10	5	Avg		%RSD
1)	tC	C8	2.277	2.425	2.559	2.711	2.206	2.436	E.4	8.43
2)	tC	C10	2.499	2.664	2.791	2.930	2.534	2.684	E4	6.68
3)	TC	C12	2.776	2.935	3.075	3.239	2.766	2.958	E4	6.83
4)	tC	C14	2.896	3.070	3.238	3.430	2.928	3.112	E4	7.18
5)	tC	C16	2.966	3.159	3.344	3.568	3.053	3.218	E4	7.49
6)	tС	C18	3.349	3.613	3.893	4.085	3.562	3.701	E4	7.82
7)	tC	C20	3.258	3.475	3.672	3.915	3.342	3.533	E4	7.50
8)	tC	C22	3.199	3.420	3.607	3.844	3.278	3.469	E4	7.51
9)	tC	C24	3.264	3.487	3.671	3.904	3.333	3.532	E4	7.37
10)	tC	C26	3.255	3.476	3.650	3.866	3.319	3.513	E4	7.10
11)	tC	C28	3.293	3.512	3.674	3.893	3.318	3.538	E4	7.11
12)	tC	C30	3.401	3.623	3.790	3.976	3.375	3.633	E4	7.05
13)	tC	C32	3.431	3.658	3.825	4.024	3.434	3.674	Ε4	6.97
14)	tC	C34	3.521	3.812	4.027	4.220	3.564	3.829	E 4	7.80
15)	tC	C36	3.385	3.858	4.127	4.279	3.664	3.863	E4	9.25
16)	tC	C38	3.166	3.924	4.329	4.459	3.853	3.946	E4	12.84
17)	tC	C40	2.828	3.816	4.405	4.438	3.846	3.867	E4	16.86
18)	tC	C42	2.580	3.759	4.424	4.447	3.820	3.806	E4	19.91
19)	TC	Pristane		3.345			3.255	3.397	E4	7.21
20)	TC	Phytane	3.270	3.492	3.694	3.945	3.369	3.554	E4	7.59
21)	sC							4.245	E4	7.46
22)	tC	TPHC - total	3.313	3.705	4.003	4.287	3.910	3.844	E4	9.44
/ # \	= 01	ut of Range				 MEDNI DI	TEDACE	DCD2		= 8 70

(#) = Out of Range MEAN AVERAGE RSD% = 8.79

TPH43.M Tue Jul 07 08:38:13 1998

Tph41

Response Factor Report GC/MS Ins

: C:\HPCHEM\l\METHODS\TPH41.M (Chemstation Integrator)

Title : TPHC Calibration 06/05/97 21 peaks

Last Update : Thu Jun 11 14:59:41 1998

100		ation Files ~T05610.D ~T05613.D	50 5	T0561	1.D 4.D	20	÷T0'	5612.D			
		<pre>%T05610.D T05613.D Compound C8 C40 C1.2 C14 C16 C18 C20</pre>		100	50	20	10	5	Avg		TRSD
1.)	11.			2.121	2.039	1,912	1.984	2.064	2,024	Е4	3.93
		C10		2.305	2.184	2.138	2.205	2.215	2.209	E4	2.76
3)		CL		2.550	2.393	2.339	2.387	2.400	2.414	$\Theta 4$	3.30
4)		C14		2.654	2.496	2.459	2.503	2.528	2.528	E4	2.96
· · · · · ·		C16		2.711	2.562	2.547	2.612	2.650	2.616	F: 4	2.56
€.)		C18		3.131	3.028	2.996	3.016	2.986	3.031	E4	1.91
7)		(b:0)		2.968	2.814	2.807	2.877	2.906	21.874	E4	2.34
용)		(112)		9 Q23	2 778	2 769	2.841	2.861	2.834	E4	2.24
9)	10	C24		2.968	2.825	2.806	21.876	2.900	2.875	E4	2.25
10)	t C	C76		2.957	2.820	2.782	2.852	2.874	2.857	E 4	2.30
11)	EC:	COR		2.992	2.851	2.799	2.873	2.863	2.876	E4	2.47
1.1)	1 + 1	('3()		3.101	2.957	2.881	2.950	2.903	2.958	E4	2.90
1 3)	t ('	C. 3.1		3.137	2.994	2.879	2.930	2.887	. 2 - 966	N 4	3.58
14)	1 (0.34		3.267	3.114	2.979	3.014	2.946	3.064	10.4	4.24
15)	t i *	C36		3.229	3.069	2.864	2.895	2.752	2.963	11.1	6.33
16)	t (*	0.38		3.100	2.923	2.657	21.575	1 1 70	3.705	15.4	11.86
17)	t,c'	C40		2.791 2.484 2.844	2.587	2.210	1.982	1.570	7.238	15.4 13.4	$\frac{21.76}{31.76}$
18)	t C	€42		2.484	2.257	1.798	1.475	1.060	4.815	15/4	$\frac{31.79}{2.54}$
19)	TC	Pristane		2.844	2.665	2.705	2.785	2.764	A.700	15 G 15 A	
20)	TC	Phytane		2.3979	2.828	6.061	7 . 0 22	F. • 17 1.17	2. • () /•/		2.29
21)				3.572	3.380	3.368	3.461	3.500	3.456	1, 4 1, 4	2.46
22)	t C	TPHC - total		3.082	2.986	2.975	3.099	3.340		P.4	
(#)	. ()	ut of Range						MEAN	RSD %		5.619

Fri Jun 12 08:15:45 1998 TPH41.M

(#) - Out of Range

Evaluate Continuing Calibration Report

Data File : C:\HPCHEM\1\DATA\980707\T05980.D

Vial: 2 Acq On : 7 Jul 98 5:02 pm Operator: Deinhardt Sample : 50 PPM STANDARD Inst : GC/MS Ins

Misc Multiplr: 1.00

IntFile : TPHCINT.E

Method : C:\HPCHEM\1\METHODS\TPH43.M (Chemstation Integrator)
Title : TPHC Calibration 06/05/97 21 peaks

Last Update : Thu Jun 11 14:59:41 1998 Response via : Multiple Level Calibration

Min. RRF : 0.000 Min. Rel. Area : 50% Max. R.T. Dev 0.50min

Max. RRF Dev : 20% Max. Rel. Area : 200%

		Compound	AvgRF	CCRF	%Dev	Area%	Dev(min)
1	tC	C8	24.358	22.956 E3	5.8	104	-0.02
	tC	C10	26.836	26.053 E3	2.9	109	0.00
	TC	C12	29.584	28.581 E3	3.4	109	0.00
4	tC	C14	31.125	29.646 E3	4.8	107	0.00
5	tC	C16	32.180	30.371 E3	5.6	107	0.00
6	tC	C18	37.007	34.812 E3	5.9	105	0.00
7	tC	C20	35.326	33.471 E3	5.3	106	0.00
8	tC	C22	34.694	32.976 E3	5.0	106	0.00
9	tC	C24	35.318	33.776 E3	4.4	107	0.00
10	tC	C26	35.130	33.791 E3	3.8	108	0.00
11	tC	C28	35.380	34.262 E3	3.2	112	0.00
12	tC	C30	36.331	35.406 E3		115	0.00
13	tC	C32	36.742	35.834 E3		116	0.00
14	tC	C34	38.289	37.660 E3		118	0.00
15	tC	C36	38.627	37.816 E3		118	0.00
16	tC	C38	39.462	38.436 E3	2.6	121	0.00
17	tC	C40	38.666	37.409 E3		124	0.00
	tC	C42	38.058	36.698 E3	3.6	129	0.00
	TC	Pristane	33.965	32.764 E3	3.5	108	0.00
	TC	Phytane	35.539	33.618 E3	5.4	106	0.00
		o-terphenyl	42.449	40.179 E3		106	0.00
22	tC	TPHC - total	38.436	35.766 E3	6.9	108	0.00

Evaluate Continuing Calibration Report

Data File : C:\HPCHEM\1\DATA\980701\T05921.D Vial: 2

Acq On : 1 Jul 98 10:26 pm Operator: Deinhardt : 50 PPM STANDARD Sample Inst : GC/MS Ins

Misc Multiplr: 1.00

IntFile : TPHCINT.E

Method : C:\HPCHEM\1\METHODS\TPH42.M (Chemstation Integrator)
Title : TPHC Calibration 06/05/97 21 peaks

Last Update : Thu Jun 11 14:59:41 1998 Response via: Multiple Level Calibration

Min. RRF : 0.000 Min. Rel. Area : 50% Max. R.T. Dev 0.50min

Max. RRF Dev : 20% Max. Rel. Area : 200%

	Compound	AvgRF	CCRF	%Dev	Area%	Dev(min)
1 tC	C8	25.015	26.513 E3	-6.0	124	-0.02
2 tC	C10	27.321	28.803 E3	-5.4	125	0.00
3 TC	C12	30.270	32.258 E3	-6.6	127	0.00
4 tC	C14	32.456	34.512 E3	-6.3	130	0.00
5 tC	C16	34.233	36.026 E3	-5.2	131	0.00
6 tC	C18	40.499	41.292 E3	-2.0	129	0.00
7 tC	C20	38.319	39.750 E3	-3.7	131	0.00
8 tC	C22	38.033	39.618 E3	-4.2	132	0.00
9 tC	C24	39.001	40.656 E3	-4.2	133	0.00
10 tC	C26	39.070	40.736 E3	-4.3	135	0.00
11 tC	C28	39.676	41.366 E3	-4.3	141	0.00
12 tC	C30	40.988	42.830 E3	-4.5	147	0.00
13 tC	C32	41.531	43.441 E3	-4.6	150	0.00
14 tC	C34	43.532	45.318 E3	-4.1	151	0.00
15 tC	C36	44.266	45.696 E3	~3.2	153	0.00
16 tC	C38	45.609	46.270 E3	-1.4	158	0.00
17 tC	C40	44.840	44.975 E3	-0.3	163	0.00
18 tC	c42	41.657	43.537 E3	-4.5	172	0.01
19 TC	Pristane	36.391	37.066 E3	-1.9	127	0.00
20 TC	Phytane	38.604	40.075 E3	-3.8	131	0.00
21 sC	o-terphenyl	46.199	48.193 E3	-4.3	132	0.00
22 tC	TPHC - total	42.357	42.408 E3	-0.1	133	0.00

Evaluate Continuing Calibration Report

Data File : C:\HPCHEM\1\DATA\980701\T05932.D Vial: 2

Acq On : 2 Jul 98 5:57 am Operator: Deinhardt : 50 PPM STANDARD Sample Inst : GC/MS Ins

Misc Multiplr: 1.00

IntFile : TPHCINT.E

b . 2

Method : C:\HPCHEM\1\METHODS\TPH42.M (Chemstation Integrator)
Title : TPHC Calibration 06/05/97 21 peaks

Last Update : Thu Jun 11 14:59:41 1998 Response via : Multiple Level Calibration

Min. RRF : 0.000 Min. Rel. Area : 50% Max. R.T. Dev 0.50min

Max. RRF Dev : 20% Max. Rel. Area : 200%

	Compound	AvgRF	CCRF	%Dev	Area%	Dev(min)
1 tC	C8	25.015	21.945 E3	12.3	103	-0.02
2 tC	C10	27.321	24.614 E3	9.9	107	0.00
3 TC	C12	30.270	27.267 E3	9.9	108	0.00
4 tC	C14	32.456	28.702 E3	11.6	108	0.00
5 tC	C16	34.233	29.638 E3	13.4	108	0.00
6 tC	C18	40.499	34.702 E3	14.3	108	0.00
7 tC	C20 .	38.319	32.739 E3	14.6	108	0.00
8 tC	C22	38.033	32.227 E3	15.3	107	0.00
9 tC	C24	39.001	32.990 E3	15.4	108	0.00
10 tC	C26	39.070	32.979 E3	15.6	109	0.00
11 tC	C28	39.676	33.409 E3	15.8	114	0.00
12 tC	C30	40.988	34.595 E3	15.6	119	0.00
13 tC	C32	41.531	35.076 E3	15.5	121	0.00
14 tC	C34	43.532	36.568 E3	16.0	122	0.00
15 tC	C36	44.266	36.853 E3	16.7	124	0.00
16 tC	C38	45.609	37.310 E3	18.2	127	0.00
17 tC	C40	44.840	36.359 E3	18.9	132	0.00
18 tC	C42	41.657	35.220 E3	15.5	139	0.00
19 TC	Pristane	36.391	31.445 E3	13.6	108	0.00
20 TC	Phytane	38.604	32.923 E3	14.7	108	0.00
21 sC	± -	46.199	39.501 E3	14.5	108	0.00
22 tC	TPHC - total	42.357	36.488 E3	13.9	114	0.00

Surrogate Recovery Report

Lab. ID#:

3690

Location #: B. 1110

			Location #:	B. 1110
Sample		Surrogate Added (ppm)	Amount Recovered (ppm)	Percent Recovery
3690.01		10.00	9.51	95.05
3690.02		10.00	8.83	88.25
3690.03		10.00	9.07	90.73
3690.04		10.00	8.65	86.53
3690.05		10.00	7.79	77.92
3690.06		10.00	8.50	85.02
3690.07		10.00	8.42	84.17
			1	
METHOD BLANK	TBLK 122	10.00	9.56	95.56

Surrogate Added :

o-Terphenyl

Matrix Spike Recovery Report

Lab. ID#:

3690

Location #:

B. 1110

Sample	Spike Amount Added (ppm)	Sample Amount (ppm)	Matrix Spike Amount (ppm)	Percent Recovery	QC Limits %
3690.03MS	1000	0.00	873.82	87.38	75-125
3690.03MSD	1000	0.00	772.41	77.24	75-125

RPD	12.32	20.00
		1

Blank Spike Recovery Report

Lab. ID#:

3690

Location #:

B. 1110

Sample	Date Extracted	1 ' 1	Matrix Spike Amount (ppm)	Percent Recovery	QC Limits %
Blank Spike	30-Jun-98	1000	906.03	90.60	75-125

Data File : C:\HPCHEM\1\DATA\980707\T05986.D

Vial: 19

Acq On : 7 Jul 98 9:10 pm

Operator: Deinhardt Inst : GC/MS Ins

Sample : 3690.01 Misc :

Multiplr: 1.00

IntFile : TPHCINT.E

Quant Time: Jul 8 7:53 1998 Quant Results File: TPH43.RES

Quant Method : C:\HPCHEM\1\METHODS\TPH43.M (Chemstation Integrator)

Title : TPHC Calibration 06/05/97 21 peaks

Last Update : Thu Jun 11 14:59:41 1998

Response via: Initial Calibration

DataAcq Meth: TPH43.M

Volume Inj. : 1 ul Signal Phase : HP-5

Signal Info : 30m x 0.32mm

Compound R.T. Response Conc Units

System Monitoring Compounds

21) sC o-terphenyl 13.90 403490 9.505 mg/L Spiked Amount 10.000 Range 8 - 13 Recovery = 95.05%#

Target Compounds

Data File : C:\HPCHEM\1\DATA\980707\T05986.D Vial: 19 Acq On : 7 Jul 98 9:10 pm Operator: Deinhardt : 3690.01 : GC/MS Ins Sample Inst Multiplr: 1.00 Misc IntFile : TPHCINT.E Quant Time: Jul 8 7:53 1998 Quant Results File: TPH43.RES Quant Method : C:\HPCHEM\1\METHODS\TPH43.M (Chemstation Integrator) Title : TPHC Calibration 06/05/97 21 peaks

Last Update : Thu Jun 11 14:59:41 1998 Response via : Multiple Level Calibration

DataAcq Meth : TPH43.M

Volume Inj. : 1 ul Signal Phase : HP-5

Signal Info : 30m x 0.32mm

T05986.D\FID1B Response_

50000 -

45000

40000 -

35000 -

30000 -

25000

20000 -

15000 -

10000

5000

0

20.00 22.00 8.00 14.00 16.00 18.00 6.00 10.00 12.00

T05986.D TPH43.M

Wed Jul 08 07:56:56 1998

Data File : C:\HPCHEM\1\DATA\980707\T05987.D Vial: 20

Acq On : 7 Jul 98 9:52 pm Sample : 3690.02 Operator: Deinhardt Inst : GC/MS Ins

Misc Multiplr: 1.00

IntFile : TPHCINT.E

Quant Time: Jul 8 7:54 1998 Quant Results File: TPH43.RES

Quant Method : C:\HPCHEM\1\METHODS\TPH43.M (Chemstation Integrator)

Title : TPHC Calibration 06/05/97 21 peaks
Last Update : Thu Jun 11 14:59:41 1998

Response via : Initial Calibration

DataAcq Meth : TPH43.M

Volume Inj. : 1 ul Signal Phase : HP-5

Signal Info : 30m x 0.32mm

Compound R.T. Response Conc Units

System Monitoring Compounds

21) sC o-terphenyl 13.90 374609 8.825 mg/L Spiked Amount 10.000 Range 8 - 13 Recovery = 88.25%#

Target Compounds

```
Data File : C:\HPCHEM\1\DATA\980707\T05987.D
                                                                  Vial: 20
  Acq On : 7 Jul 98
                             9:52 pm
                                                              Operator: Deinhardt
            : 3690.02
                                                                     : GC/MS Ins
  Sample
                                                              Inst
                                                              Multiplr: 1.00
  Misc
  IntFile
            : TPHCINT.E
  Quant Time: Jul 8 7:54 1998 Quant Results File: TPH43.RES
  Quant Method : C:\HPCHEM\1\METHODS\TPH43.M (Chemstation Integrator)
  Title : TPHC Calibration 06/05/97 21 peaks
  Last Update : Thu Jun 11 14:59:41 1998
  Response via : Multiple Level Calibration
  DataAcq Meth: TPH43.M
  Volume Inj. : 1 ul
  Signal Phase : HP-5
  Signal Info : 30m x 0.32mm
Response_
50000
                                     T05987.D\FID1B
  48000
  46000
  44000
  42000
  40000 -
  38000
  36000
  34000
  32000
  30000
  28000
  26000
  24000
  22000
  20000
  18000
  16000
  14000
   12000
   10000
   8000
   6000
   4000
   2000
   -2000
   4000
                                                               20.00
                                                                      22.00
                                                16.00
                                                        18.00
             6.00
                    8.00
                           10.00
                                  12.00
                                         14.00
     4.00
```

Wed Jul 08 07:57:02 1998

T05987.D

TPH43.M

Data File : C:\HPCHEM\1\DATA\980707\T05988.D Vial: 21

Acq On : 7 Jul 98 10:34 pm Operator: Deinhardt Sample : 3690.03 Misc : Inst : GC/MS Ins

Misc Multiplr: 1.00

IntFile : TPHCINT.E

Ouant Time: Jul 8 7:54 1998 Quant Results File: TPH43.RES

Quant Method : C:\HPCHEM\1\METHODS\TPH43.M (Chemstation Integrator)

Title : TPHC Calibration 06/05/97 21 peaks

Last Update : Thu Jun 11 14:59:41 1998 Response via : Initial Calibration DataAcq Meth : TPH43.M

Volume Inj. : 1 ul Signal Phase : HP-5

Signal Info : 30m x 0.32mm

R.T. Response Conc Units Compound

System Monitoring Compounds

21) sC o-terphenyl 13.90 385128 9.073 mg/L Spiked Amount 10.000 Range 8 - 13 Recovery = 90.73%#

Target Compounds

Data File : C:\HPCHEM\1\DATA\980707\T05988.D Vial: 21 : 7 Jul 98 10:34 pm Operator: Deinhardt Acq On Sample : 3690.03 : GC/MS Ins Inst Misc Multiplr: 1.00 IntFile : TPHCINT.E Quant Time: Jul 8 7:54 1998 Quant Results File: TPH43.RES Quant Method : C:\HPCHEM\1\METHODS\TPH43.M (Chemstation Integrator) : TPHC Calibration 06/05/97 21 peaks Title Last Update : Thu Jun 11 14:59:41 1998 Response via : Multiple Level Calibration DataAcq Meth : TPH43.M Volume Inj. : 1 ul Signal Phase : HP-5 Signal Info : 30m x 0.32mm Response_ 50000 45000 40000 35000 30000 -25000 20000 15000 10000 5000

Wed Jul 08 07:57:08 1998

14.00

16.00

18.00

12.00

Page 2

20.00

22.00

4.00

6.00

8.00

10.00

Multiplr: 1.00

Data File : C:\HPCHEM\1\DATA\980701\T05930.D Vial: 22

Acq On : 2 Jul 98 4:35 am Operator: Deinhardt Sample : 3690.04 Inst : GC/MS Ins

Misc

وريا

IntFile : TPHCINT.E

Quant Time: Jul 6 8:19 1998 Quant Results File: TPH42.RES

Quant Method : C:\HPCHEM\1\METHODS\TPH42.M (Chemstation Integrator)

Title : TPHC Calibration 06/05/97 21 peaks

Last Update : Thu Jun 11 14:59:41 1998

Response via : Initial Calibration DataAcq Meth : TPH42.M

Volume Inj. : 1 ul Signal Phase : HP-5

Signal Info : 30m x 0.32mm

Compound	R.T.	Response	Conc Units
System Monitoring Compounds 21) sC o-terphenyl	13.90		8.653 mg/L
Spiked Amount 10.000 Range	8 - 13	Recovery =	86.53%#
Target Compounds			
5) tC C16	12.42	2197	0.064 mg/L
6) tC C18	12.87	7023	• · ·
7) tC C20	13.40	3748	0.098 mg/L
8) tC C22	14.16	2869	0.075 mg/L
9) tC C24	14.86	1403	0.036 mg/L
10) tC C26	15.48	1673	0.043~mg/L
12) tC C30	16.96	1608	0.039 mg/L
13) tC C32	17.54	1069	0.026 mg/L
19) TC Pristane	12.98	1039	0.029 mg/L
20) TC Phytane	13.40	3748	0.097 mg/L
22) tC TPHC - total	13.90	5267852	124.368 mg/L m

Data File : C:\HPCHEM\1\DATA\980701\T05930.D Vial: 22 : 2 Jul 98 4:35 am Acq On Operator: Deinhardt : 3690.04 Sample Inst : GC/MS Ins Misc Multiplr: 1.00 IntFile : TPHCINT.E Quant Time: Jul 6 8:19 1998 Quant Results File: TPH42.RES Quant Method : C:\HPCHEM\1\METHODS\TPH42.M (Chemstation Integrator) Title : TPHC Calibration 06/05/97 21 peaks Last Update : Thu Jun 11 14:59:41 1998 Response via : Multiple Level Calibration DataAcq Meth: TPH42.M Volume Inj. : 1 ul Signal Phase : HP-5 Signal Info : 30m x 0.32mm T05930.D\FID1B Response_ 55000 50000 45000 40000 35000 30000 25000 20000 15000 10000 5000 0 16.00 18.00 20.00 22.00 8.00 10.00 12.00 Time 4.00 6.00

Mon Jul 06 14:28:07 1998

T05930.D TPH42.M

Vial: 23

Data File : C:\HPCHEM\1\DATA\980701\T05931.D

Acq On : 2 Jul 98 5:16 am Operator: Deinhardt : 3690.05 Sample Inst : GC/MS Ins

Multiplr: 1.00

Misc : IntFile : TPHCINT.E

Ouant Time: Jul 6 8:19 1998 Quant Results File: TPH42.RES

Quant Method : C:\HPCHEM\1\METHODS\TPH42.M (Chemstation Integrator)

Title : TPHC Calibration 06/05/97 21 peaks

Last Update : Thu Jun 11 14:59:41 1998

Response via : Initial Calibration

DataAcq Meth : TPH42.M

Volume Inj. : 1 ul Signal Phase : HP-5

Signal Info : 30m x 0.32mm

Compound R.T. Response Conc Units

System Monitoring Compounds

21) sC o-terphenyl 13.90 359980 7.792 mg/L Spiked Amount 10.000 Range 8 - 13 Recovery = 77.92%#

Target Compounds

Data File : C:\HPCHEM\1\DATA\980701\T05931.D

```
Acq On
               2 Jul 98
                             5:16 am
                                                              Operator: Deinhardt
  Sample
             : 3690.05
                                                                     : GC/MS Ins
  Misc
                                                              Multiplr: 1.00
             : TPHCINT.E
  IntFile
  Ouant Time: Jul
                    6 8:19 1998 Quant Results File: TPH42.RES
  Ouant Method : C:\HPCHEM\1\METHODS\TPH42.M (Chemstation Integrator)
                : TPHC Calibration 06/05/97 21 peaks
  Title
  Last Update : Thu Jun 11 14:59:41 1998
  Response via : Multiple Level Calibration
  DataAcq Meth: TPH42.M
  Volume Inj. : 1 ul
  Signal Phase : HP-5
  Signal Info : 30m x 0.32mm
                                      T05931.D\FID1B
Response_
  48000
  46000
  44000
  42000
  40000
  38000
  36000
  34000
  32000
  30000
  28000
  26000
  24000
  22000
  20000
  18000
  16000
  14000
  12000
  10000
   8000
   6000
   4000
   2000
     0
   -2000
   -4000
                                       14.00
     4.00
             6.00
                    8.00
                           10.00
```

T05931.D TPH42.M

Mon Jul 06 14:28:13 1998

Vial: 23

Data File : C:\HPCHEM\1\DATA\980701\T05933.D
Vial: 25

Acq On : 2 Jul 98 6:37 am Operator: Deinhardt Sample : 3690.06 Inst : GC/MS Ins

Misc : Multiplr: 1.00

IntFile : TPHCINT.E

Quant Time: Jul 6 8:20 1998 Quant Results File: TPH42.RES

Quant Method : C:\HPCHEM\1\METHODS\TPH42.M (Chemstation Integrator)

Title : TPHC Calibration 06/05/97 21 peaks Last Update : Thu Jun 11 14:59:41 1998

Response via: Initial Calibration

DataAcq Meth: TPH42.M

Volume Inj. : 1 ul Signal Phase : HP-5

Signal Info : 30m x 0.32mm

Compound R.T. Response Conc Units

System Monitoring Compounds

21) sC o-terphenyl 13.90 392798 8.502 mg/L

Spiked Amount 10.000 Range 8 - 13 Recovery = 85.02%#

Target Compounds

22) tC TPHC - total 13.90 1551536 36.630 mg/L m

Data File : C:\HPCHEM\1\DATA\980701\T05933.D Vial: 25

Acq On : 2 Jul 98 6:37 am Operator: Deinhardt Sample : 3690.06 Inst : GC/MS Ins

Misc : Multiplr: 1.00

IntFile : TPHCINT.E

Quant Time: Jul 6 8:20 1998 Quant Results File: TPH42.RES

Quant Method : C:\HPCHEM\1\METHODS\TPH42.M (Chemstation Integrator)

Title : TPHC Calibration 06/05/97 21 peaks Last Update : Thu Jun 11 14:59:41 1998

Last Update : Thu Jun 11 14:59:41 1998 Response via : Multiple Level Calibration

DataAcq Meth: TPH42.M

Volume Inj. : 1 ul Signal Phase : HP-5

Signal Info : 30m x 0.32mm

Response_ T05933.D\FID1B

50000

45000

40000

35000

30000

25000 -

20000

15000

10000

5000 -

Time 4:00 6.00 8.00 10.00 12.00 14.00 16.00 18.00 20.00 22.00

Data File : C:\HPCHEM\1\DATA\980701\T05934.D

Vial: 26 Acq On : 2 Jul 98 7:18 am Operator: Deinhardt

Sample : 3690.07 Inst : GC/MS Ins Multiplr: 1.00

Misc IntFile : TPHCINT.E

Ouant Time: Jul 6 8:29 1998 Quant Results File: TPH42.RES

Quant Method: C:\HPCHEM\1\METHODS\TPH42.M (Chemstation Integrator)

Title : TPHC Calibration 06/05/97 21 peaks

Last Update : Thu Jun 11 14:59:41 1998 Response via : Initial Calibration

DataAcq Meth: TPH42.M

Volume Inj. : 1 ul Signal Phase : HP-5

Signal Info : 30m x 0.32mm

Compound R.T. Response Conc Units

System Monitoring Compounds

21) sC o-terphenyl 13.90 388836 8.417 mg/L Spiked Amount 10.000 Range 8 - 13 Recovery = 84.17%#

Target Compounds

Data File : C:\HPCHEM\1\DATA\980701\T05934.D Vial: 26 2 Jul 98 7:18 am Operator: Deinhardt Acq On : : 3690.07 Sample Inst : GC/MS Ins Misc Multiplr: 1.00 IntFile : TPHCINT.E Quant Time: Jul 6 8:29 1998 Quant Results File: TPH42.RES Quant Method: C:\HPCHEM\1\METHODS\TPH42.M (Chemstation Integrator) Title : TPHC Calibration 06/05/97 21 peaks Last Update : Thu Jun 11 14:59:41 1998 Response via: Multiple Level Calibration DataAcq Meth : TPH42.M Volume Inj. : 1 ul Signal Phase : HP-5 Signal Info : $30m \times 0.32mm$ T05934.D\FID1B Response_ 50000 48000 46000 44000 42000 40000 38000 36000 34000 32000 30000 28000 26000 24000 22000 20000 18000 16000 14000 12000 10000 8000 6000 4000 2000 0 -2000 -4000 8.00 10.00 12.00 14.00 18.00 20.00 Time 4.00 6.00 16.00 22.00

T05934.D TPH42.M Mon Jul 06 14:28:25 1998

LABORATORY DELIVERABLES CHECKLIST AND NON-CONFORMANCE SUMMARY

THIS FORM MUST BE COMPLETED BY THE LABORATORY OR ENVIRONMENTAL CONSULTANT AND ACCOMPANY ALL DATA SUBMISSIONS

The following Laboratory Deliverables checklist and Non-Conformance Summary shall be included in the data submission. All deviations from the accepted methodology and procedures, of performance values outside acceptable ranges shall be summarized in the Non-Conformance Summary. The Technical Requirements for Site Remediation, effective June 7, 1993, provides further details. The document shall be bound and paginated, contain a table of contents, and all pages shall be legible. Incomplete packages will be returned or held without review until the data package is completed.

It is recommended that the analytical results summary sheets listing all targeted and non-targeted compounds with the method detection limits, practical quantitation limits, and the laboratory and/or sample numbers be included in one section of the data package <u>and</u> in the main body of the report.


1.	Cover page. Title Page listing Lab Certification =, facility name and address, & date of report submitted	
2.	Table of Contents submitted	
3.	Summary Sheets listing analytical results for all targeted and non-targeted compounds submitted	
4.	Document paginated and legible	
5.	Chain of Custody submitted	
6.	Samples submitted to lab within 48 hours of sample collection	
7.	Methodology Summary submitted	
8.	Laboratory Chronicle and Holding Time Check submitted	
9.	Results submitted on a dry weight basis	
10.	Method Detection Limits submitted	
11.	Lab certified by NJDEP for parameters of appropriate category of parameters or a member of the USEPA CLP	
Lab Dat	poratory Manager or Environmental Consultant's Signature	
Lat	poratory Certification =13461	
	*Refer to NIAC 7:26E - Appendix A. Section IV - Reduced Data Deliverables - Non-L'SEPA/CLE	


Methods for further guidance.

APPENDIX F

PHOTOGRAPHS



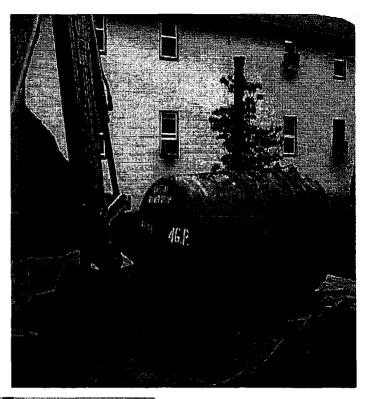

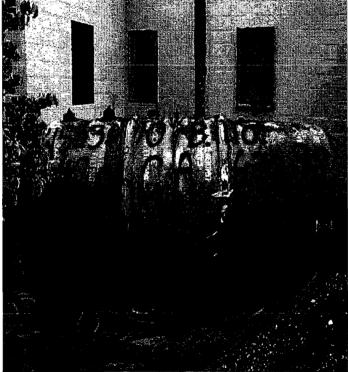

June 30, 1998

PHOTOGRAPHIC LOG

UST NO. 81533-170

Building 1110 Main Post-West Fort Monmouth



SMC ENVIRONMENTAL
SERVICES GROUP
Engineers, Managers, Scientists & Planners
VALLEY FORGE, PA.